
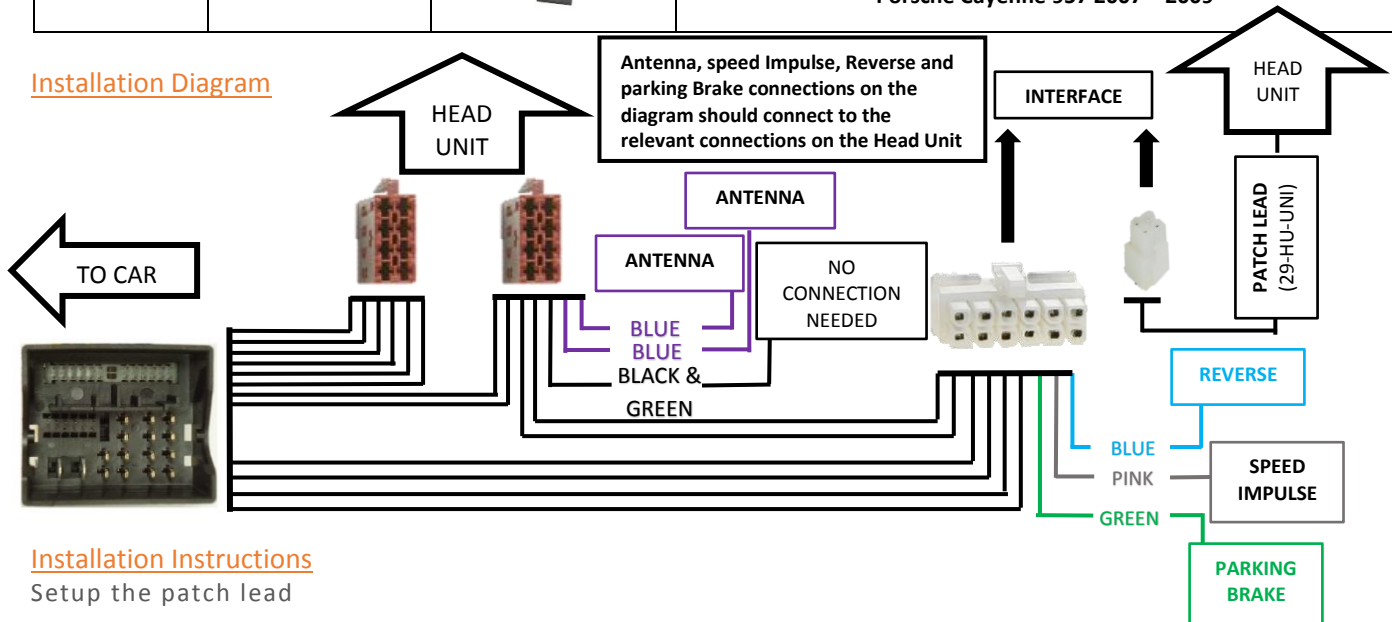


InCarTec 39-PO-QUAD

Component List





Part Number	Component	Image	Description
39-PO-QUAD	Steering control Interface		39-PO-QUAD CANbus steering wheel control interface retains the use of the audio steering wheel controls and also provides CAN ignition, reverse gear, illumination, parking brake and speed pulse output signals. Porsche Cayenne 957 2007 – 2009

Installation Diagram



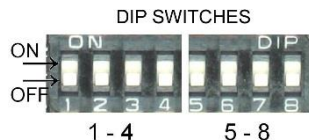
Installation Instructions

Setup the patch lead

	Pioneer and Sony Pin 1 black (base) Pin 2 red (middle) Pin 3 not connected Pin 4 white (tip)		Alpine, Clarion and JVC Pin 1 black (base) Pin 2 white (tip) Pin 3 not connected Pin 4 red (middle)		JVC, Kenwood and Zenec Pin 1 not connected Pin 2 blue (single wire) Pin 3 not connected Pin 4 not connected		Chinese/Learning Pin 1 not connected Pin 2 blue (single wire) Pin 3 not connected Pin 4 blue (single wire)
--	--	---	---	---	---	---	--

The 4-pin patch lead connector diagrams above are viewed from the wire entry side of the connector.

Set the switches



The switches on the interface need to be set according to the brand of radio and vehicle model. Open the black box and set the switches.

See the tables below for the switch settings. Switches 1-4 relate to the brand of head unit and switched 5-8 relate to the model of car.

Switch	1	2	3	4	5	6	7	8	Vehicle model
Alpine	Off	On	Off	Off	On	Off	Off	Off	All models
Kenwood	On	On	Off	Off					
JVC	Off	Off	On	Off					
Clarion	Off	On	On	Off					
Zenec	Off	Off	Off	On					
Sony	On	Off	On	On					
Pioneer	Off	On	On	On					
Chinese/Learning	On	Off	Off	On					

When connected the green light will indicate that the interface is recognising the vehicles CAN bus, and the yellow light will indicate the interface is giving out an ignition power supply.

If the green light is not illuminated, check the CANbus connections and switch settings.

LED STATUS



- 1 Green
- 2 Yellow

Green— CANbus active
Yellow— Ignition output active

Troubleshooting

- Check that head-unit is earthed and the black wire is earth.
- Check all connections are secure and properly insulated.

If the problem persists, go online to our website for more technical help.