


Pioneer steering control

Interface power feed issue

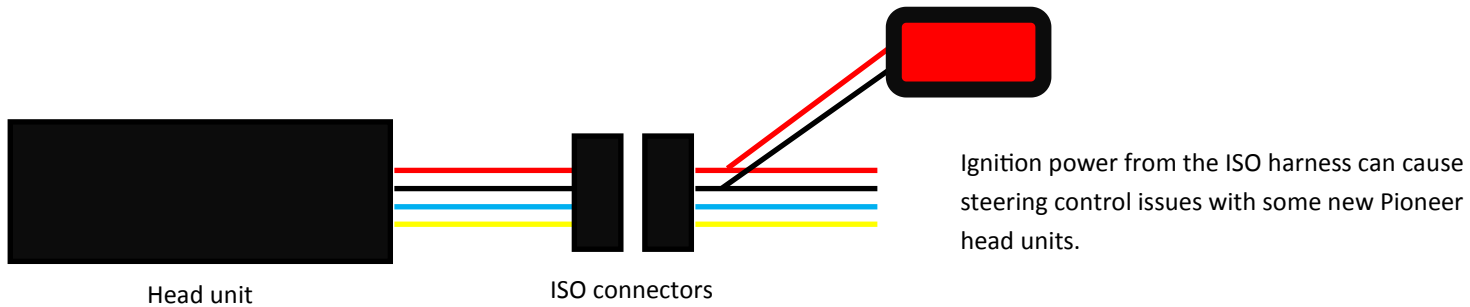

Some new Pioneer head units do not respond correctly to the steering controls. This is due to a voltage supply issues from the car to the interface.

To fix this issue, disconnect the red power wire to the interface from the ignition power in the ISO connector.

Use the blue antenna output trigger from the new headunit to power the interface as shown below.

Using the output trigger (blue wire) from the head unit to power the interface will fix the steering control issues.

