





Part number 29-808

Citroen C4 with Multifunction steering wheel
Automotive CAN Steering Control & service Interface.

Steering Control Functions:


Volume up
Volume Down
Seek Up
Seek Down
Source
Preset
Mute

CAN Service
Steering Control
Handbrake
Reverse
Illumination
Ignition 12V (1st stage)

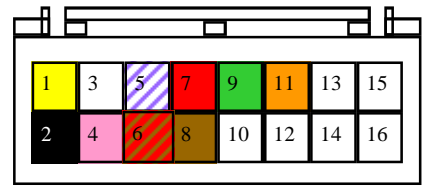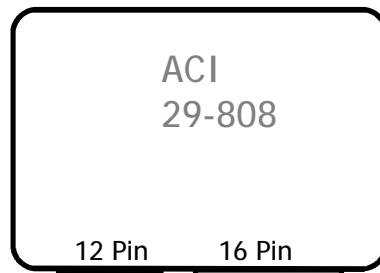


1- Yellow	Battery in	9- Green	Handbrake
2- Black	Ground	10-NC	
3- NC		11- Orange	Illumination ou
4- Pink	Speed pulse	12-NC	
5- Purple/White	Reverse	13-NC	
6- Brown/Red	CAN High	14-NC	
7- Red	Ignition out	15-NC	
8- Brown	CAN Low	16-NC	

Radio patch lead
29-xx
Supplied separately

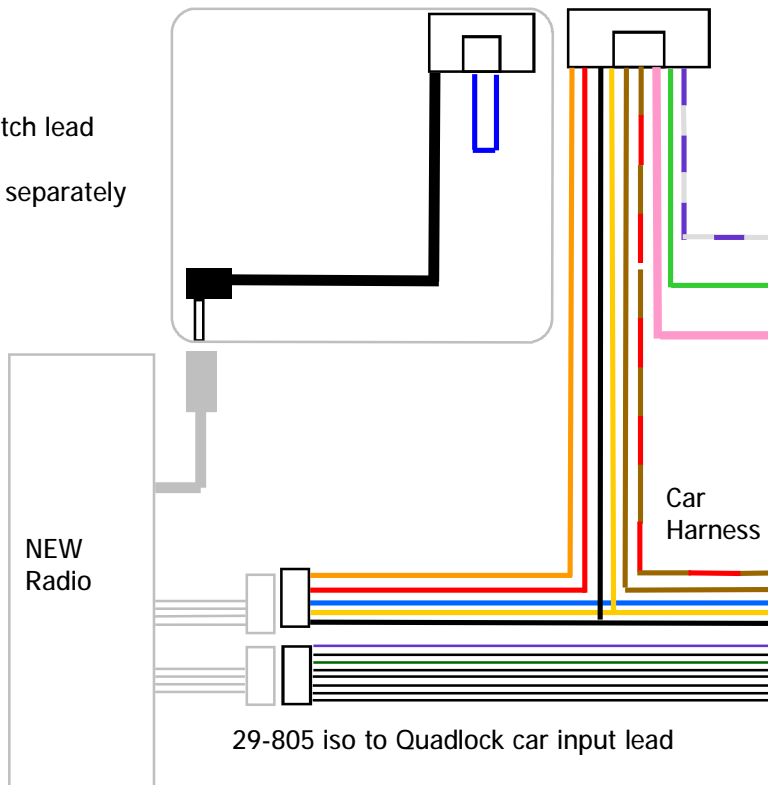

- Purple/white- Reverse +12V
- Green— Handbrake
- Pink— Speed pulse 1khz

29-808 Connector– Wire Entry Side

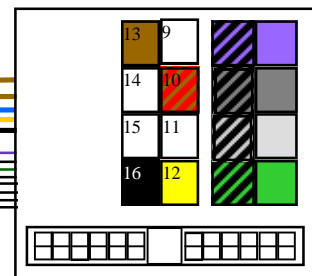

9-Brown/Red	CAN high
10-Brown	CAN low
11-NC	
12-Black	Ground
13-NC	
14-NC	
15-Yellow	Battery 12V
16- NC	


1. Connect the 12 pin Head-unit adapter (see overleaf for models) to the main ACI Black box. **It is very important that this lead is connected before any power is supplied to the unit.**
2. Make sure that the 16 pin connector is plugged in .
3. Connect the radio ISO connectors to the ACI harness and then the Quadlock connector to the car's original connector.
4. Turn on the key ignition and check to see that 12V power is being supplied to the new radio.
5. Check the steering functions
6. Connect ground to car chassis to prevent audio noise

Note. To reset the ACI unit (to plug in a different Head-unit adapter) remove the power supply three times.

Ignore the microswitch between the two connectors . The normal correct position for this switch is towards the larger 16 pin connector.

29-808 Operation instructions for Citroen C4

Removing the radio on the C4 loses the Seek down and Source function so we have utilized some of the other buttons to do these functions

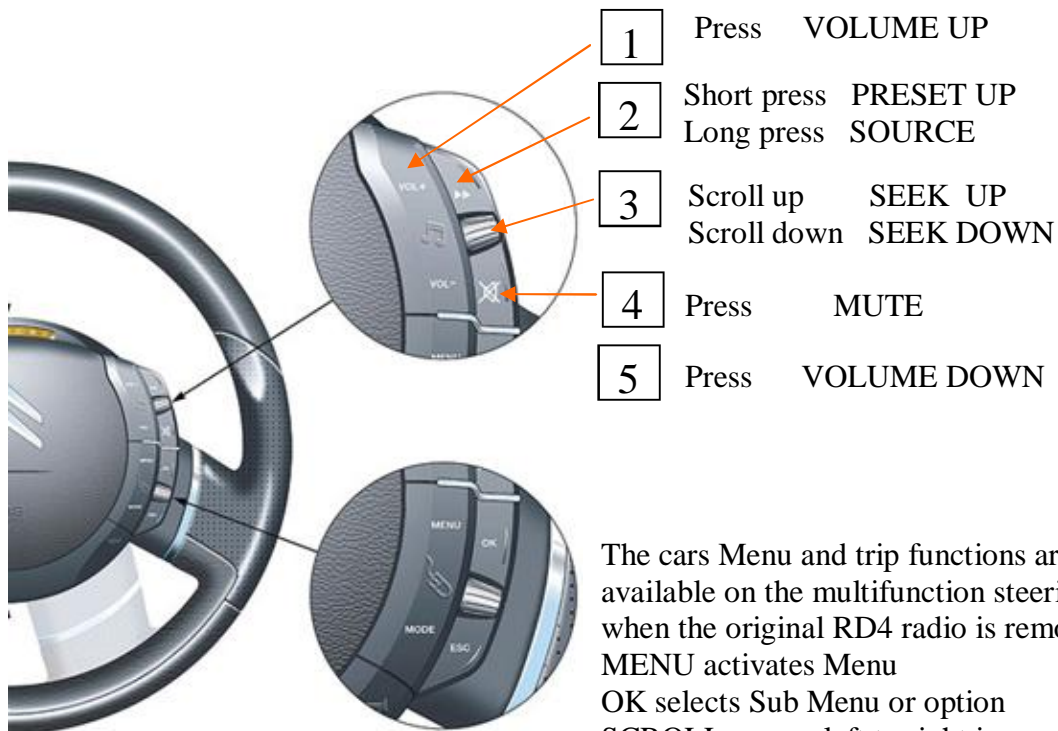

- 1 Press VOLUME UP
- 2 Short press PRESET UP
Long press SOURCE
- 3 Scroll up SEEK UP
Scroll down SEEK DOWN
- 4 Press MUTE
- 5 Press VOLUME DOWN

The cars Menu and trip functions are still available on the multifunction steering wheel when the original RD4 radio is removed
 MENU activates Menu
 OK selects Sub Menu or option
 SCROLL moves left to right in menu
 ESC escapes Menu
 MODE Changes display from Trip to Date & Time

CHOOSE THE CORRECT HEAD-UNIT PATCH LEAD FROM THOSE BELOW

IMPORTANT NOTE :Patch lead Item 29-020 Pioneer/Sony IS NOT SUPPORTED on 29-8xx CAN Series interfaces. Use 29-007-3v Pioneer and 29-008 Sony.

29-000
Fixed Voltage 2 wire

29-001
Alpine
Link 9&10

29-003
Clarion
Link 5&6, 11&12

29-004
JVC jack or wire
Link 11&12

29-002
Old Blaupunkt

29-005
Kenwood Single wire
Link 7&8

29-005 D
Kenwood Din or wire
Link 7 & 8

29-007-3v
Pioneer 3 volt
Link 5&6, 7&8

29-008
Sony
Link 7&8, 9&10

29-016
Fixed Voltage jack